

TEMPEST[®] excellence SERVICE LETTER

Service Letter Number: SL-001

Subject: DRY AIR PUMP SHEAR COUPLING SERVICE LIFE


Applicability: Aero Accessories, LLC air pumps installed in single-engine and multi-engine aircraft.

TIME OF COMPLIANCE: As Required

Conditions such as heat, oils, solvents may shorten the useful life of the urethane shear coupling. To prevent failure, Aero Accessories, LLC recommends the coupling be replaced every six (6) years from the date that Air Pump enters into service. The shear coupling must be replaced by an authorized mechanic.

Coupling Assembly Kit Part Number: 82-06768

- | | |
|----------------------------------|----------------------|
| A. 1 each Shear Coupling | P/N 82-00067 |
| B. 1 each External Drive | P/N 82-00068 |
| C. 1 each Mounting Gasket | P/N 82-50130- |

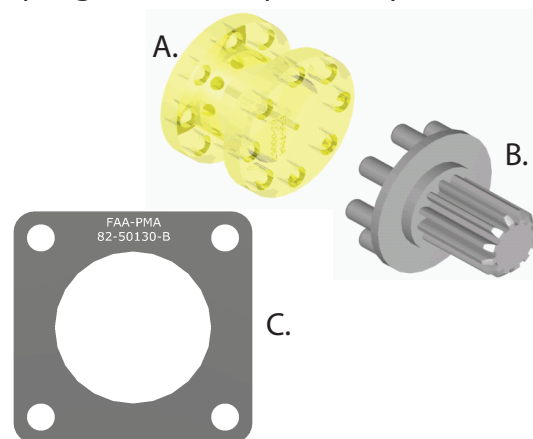

Eligible on the following pump models:

200CC , 200CW	241CC , 242CW Series
211CC , 212CW	441CC , 442CW Series
AA211CC , AA212CW	AA241CC , AA242CW Series
AA215CC , AA216CW	AA441CC , AA442CW Series
AA3215CC , AA3216CW	CH241CC , CH242CW Series
CH215CC , CH216CW	CH441CC , CH442CW Series

Failure of an air pump may result in the loss of the pneumatically powered gyro flight instruments, autopilot, and deicing systems. IMC equipped aircraft should have a pneumatic backup to provide pneumatic power in the event the aircraft's primary pump fails.

ISSUED			REVISED			 Aero Accessories, LLC 2208 Air Park Drive Burlington, N.C. USA	PAGE No.	REVISION
MO	DAY	YR	MO	DAY	YR			
01	01	89	02	07	20		1 of 1	E